
# Agilent N3970A Optical Power Meter / N3974A Dual Laser Source and N3977A Automated Optical Attenuator.

**Technical Specifications** 





The Agilent Power Meter, Light Source and Attenuator are produced to the ISO 9001 international quality system standard and are CE compliant as part of Agilent's commitment to continually increasing customer satisfaction through improved quality control.

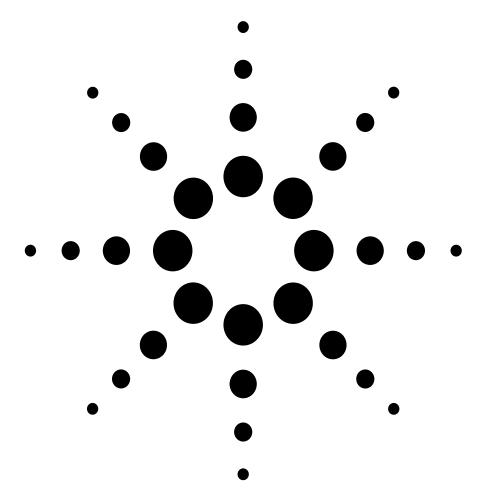

## **N3970A Optical Power Meter**

# **Performance Specifications**

Sensor Element	InGaAs	
Wavelength Range	850 - 1650 nm	
Calibration Wavelengths	850 <sup>1</sup> , 1300, 1310, 1550 nm	
Power Range	+5 to -60 dBm (850 nm)	
	+ 5 to -70 dBm (other wavelengths)	
Maximum Input Power	+ 15 dBm	
Uncertainty at reference conditions <sup>2</sup>	±0.13 dB (±3%)	
Total Uncertainty <sup>3</sup>	$\pm 0.3 \text{ dB } (\pm 7\%) \pm 2 \text{ pW}$	
Autotest sensitivity (typical) <sup>4</sup>	-40 dBm (850 nm)	
	-50 dBm (other wavelengths)	
Operating Time (typical)	250 hours	
Applicable Fiber Type	9/125 μm to 62.5/125 μm	
Optical Input	Non-Contact, Removable Connector Adapters	
Display Type	LCD, 4 digits	
Display Resolution	0.01dB, 3 digits in linear mode	
Display Units	dB, dBm, nW, μW, mW	

- 1: All specifications at 850 nm are typical.
- 2:  $23 \pm 3^{\circ}$ K, -10 to -30 dBm, calibration wavelengths  $\pm 2$ nm, fiber type standard SMF, connector type ceramic FC / PC, at day of calibration.
- 3: includes uncertainty contributions due to: uncertainty at reference conditions, varying optical connector types, fiber types up to 62.5 µm core diameter and numerical aperture up to 0.3, operation within power range and within operating temperature range.
- 4: Tested at room temperature, using an optical attenuator.

## **General Specifications**

Size	190 x 130 x 70 mm, 7.9" x 5.4 x 2.9	
Weight	500 gm, 1.1lb. Shipping 2Kg, 4.4 lb	
Operating / storage	-10 to 55°C / -25 to 70°C	
Power	2 alkaline C cells (7.6 A/hr) or external 9V DC with 2.5mm +ve pin	
	Selectable auto-off, low battery indicator back lit display	
Tone detection	100 – 9999 Hz 1%	
Man / min	Recording feature for stability testing	
Hidden keypad	For setting advanced functions	
Damage level	> 5 db above max reading	
Case	Polycarbonate, 1 meter drop tested	
RS232	3.5 mm jack connector, 0.3 – 56 Kbaud, default 9.6 K	
Printing	Not supported	

## **Ordering Information**

Instrument

N3970A Optical Power Meter

Standard accessories: (Included with instrument)

FC, ST, SC optical connector, manual, batteries, certificate of calibration, carry strap, pouch & protective holster. This instrument is equipped with interchangeable optical connector adaptors, and works with PC connectors.

The N3970A Optical Power Meter is supplied with a straight contact output connector interface. To connect to the instrument, you must attach your connector interface to the interface adaptor, then connect your cable.

Agilent service Product No.	Description
N3979-63240	ST
N3970-63246	SC
N3970-63251	FC

Optional Accessories:

Agilent Product No. Description

N3979A <sup>1</sup> Power Supply 9V DC.

Option:

Agilent Product No. Description

N3973A Loss Test Companion Software and RS-232 cable

N3978A 2 Instrument Carry Case.

## N3974A Dual Laser Source

## **Performance Specifications**

Source Type	Fabry-Perot Laser
Center Wavelength <sup>1</sup>	$1310 \pm 20 \text{ nm}$
	$1550 \pm 20 \text{ nm}$
Spectral Bandwidth (typical)	3 nm FWHM
Output Power	≥ -6 dBm
Short-term stability (typical) <sup>2</sup>	± 0.02 dB
Long-term stability (typical) <sup>3</sup>	± 0.15 dB
Operating Time (typical)	140 hours
Temperature coefficient (typical)	0.4 nm/°K
Applicable Fiber Type	9/125 μm
Optical Output	Removable Connector Adapters. Single port, Open beam

<sup>1.</sup> At 25°C - ambient temperature.

<sup>&</sup>lt;sup>1</sup> Not available in Australia, Korea, Japan, Mexico & South Africa.


- 2. No warm up, 15 min, at stable temperature, within operating temperature range.
- 3. No warm up, 8 hours, within operating temperature range.

### **General Specifications**

Size	190 x 130 x 70 mm, 7.9" x 5.4 x 2.9
Weight	500 gm, 1.1lb. Shipping 2Kg, 4.4 lb
Operating / storage	-10 to 55°C / -25 to 70°C
Power	2 alkaline C cells (7.6 A/hr) or external 9V DC with 2.5mm +ve pin.
	Selectable auto-off, low battery indicator back lit display
Modulation frequency	270 Hz, 1 KHz, 2 KHz
Hidden keypad	For setting advanced functions
Case	Polycarbonate, 1 meter drop tested
Printing	Not supported

#### **Laser Safety Information**

In the USA, all laser sources specified by this data sheet are classified as Class I according to 21 CFR 1040.10 (1999). Internationally, the same laser sources are classified as Class 1 according to IEC 60825-1 (1998).



## **Ordering Information**

Connector options.

This instrument is equipped with interchangeable optical connector adaptors. The ferrule type for light sources is PC.

Instrument

N3974A Dual Laser Source.

Standard accessories (included with instrument):

SC, ST, FC optical connector, manual, batteries, certificate of calibration, carry strap, pouch and protective holster.

The N3974A Dual Laser Source is supplied with a straight contact output connector interface. To connect to the instrument, you must attach your connector interface (see list connector interfaces below) to the interface adaptor, then connect your cable.

Agilent service Product No. Description

 N3979-63240
 ST

 N3970-63246
 SC

 N3970-63251
 FC

Optional Accessories:

Agilent Product No. Description

N3979A <sup>1</sup> Power Supply 9V DC.

Option:

Agilent Product No.

Description

N3973A Loss Test Companion Software and RS-232 cable

N3978A 2 instrument Carry Case.

# N3977A Automated Optical Attenuator

# **Performance Specifications**

Calibration wavelengths	1310 nm and 1550 nm.		
Wavelength dependence (1200 - 1600 nm):			
Attenuation $\approx A_{displayed} - 0.00027 \Delta \lambda \cdot (5 + A_{displayed})$ typ.			
where $A_{ ext{displayed}}$ is the displayed attenua	ation in dB and $\Delta\lambda$ = wavelength difference from calibration		
wavelengths in nm.			
Wavelength Range	1200 to 1600 nm		
Attenuation Range	2.50 to 60.00 dB		
Repeatability	$\pm$ 0.03 dB		
	(at fixed polarization state)		
Insertion loss			
at LOW position	< 2.5 dB		
Linearity	$\pm 0.003  dB/dB \pm 0.05  dB$		
	(at fixed polarization state, for the specified attenuation range, no		
	optical discontinuity during adjustment)		
Warm-up period	None		
Thermal stability	$\pm 0.02$ dB typical over temperature range, at fixed polarization state,		
	exclusive of connector drift		
Maximum input power	< 200 mW, +23 dBm		
Applicable Fiber Type	9/125 μm		
Return Loss (typical)	< -40dB with physical-contact connectors of perfect quality		
Operating Time	200 – 600 hour's typ depending on motor use (backlight off) from 2		
	alkaline C cells		

<sup>&</sup>lt;sup>1</sup> Not available in Australia, Korea, Japan, Mexico & South Africa.

## **General specifications**

Size	190 x 130 x 70 mm, 7.9" x 5.4 x 2.9
Weight	500 gm, 1.1lb. Shipping 2Kg, 4.4 lb
Operating / storage	-10 to 55°C / -25 to 70°C
Power	2 alkaline C cells (7.6 A/hr) or external 9V DC with 2.5mm +ve pin.
	Selectable auto-off, low battery indicator back lit display
Hidden keypad	For setting advanced functions
Case	Polycarbonate, 1 meter drop tested
Printing	Not supported

## **Ordering Information**

Instrument

N3977A Automated Optical Attenuator

Standard accessories (included with instrument):

2 sets of SC, ST, FC optical connectors, manual, batteries, certificate of calibration, carry strap, pouch and protective holster.

The N3977A Automated Optical Attenuator is supplied with a straight contact output connector interface. To connect to the instrument, you must attach your connector interface (see list connector interfaces below) to the interface adaptor, then connect your cable.

Agilent service Product No.	Description
N3970-63240	ST
N3970-63246	SC
N3970-63251	FC

Optional Accessories:

Agilent Product No. Description

N3979A <sup>1</sup> Power Supply 9V DC

Option:

Agilent Product No. Description

N3978A 2 instrument Carry Case.

Related Agilent literature:

Agilent Handhelds Photocard p/n 5988-1066EN

Agilent Technologies'

<sup>&</sup>lt;sup>1</sup> Not available in Australia, Korea, Japan, Mexico & South Africa.

Test and Measurement Support, Services, and Assistance

Agilent Technologies aims to maximize the value you receive, while minimizing your risk and problems. We strive to ensure that you get the test and measurement capabilities you paid for and obtain the support you need. Our extensive support resources and services can help you choose the right Agilent products for your applications and apply them successfully. Every instrument and system we sell has a global warranty. Support is available for at least five years beyond the production life of the product. Two concepts underlie Agilent's overall support policy: "Our Promise" and "Your Advantage."

#### Our Promise

Our Promise means your Agilent test and measurement equipment will meet its advertised performance and functionality. When you are choosing new equipment, we will help you with product information, including realistic performance specifications and practical recommendations from experienced test engineers. When you use Agilent equipment, we can verify that it works properly, help with product operation, and provide basic measurement assistance for the use of specified capabilities, at no extra cost upon request. Many self-help tools are available.

#### Your Advantage

Your Advantage means that Agilent offers a wide range of additional expert test and measurement services, which you can purchase according to your unique technical and business needs. Solve problems efficiently and gain a competitive edge by contracting with us for calibration, extra-cost upgrades, out-of-warranty repairs, and on-site education and training, as well as design, system integration, project management, and other professional engineering services. Experienced Agilent engineers and technicians worldwide can help you maximize your productivity, optimize the return on investment of your Agilent instruments and systems, and obtain dependable measurement accuracy for the life of those products.

By internet, phone, or fax, get assistance with all your test & measurement needs

Online assistance: www.agilent.com/comms/otdr

Phone or Fax United States: (tel) 1 800 452 4844

Canada: (tel) 1 877 894 4414 (fax) (905) 206 4120

Europe: (tel) (31 20) 547 2323 (fax) (31 20) 547 2390

Japan: (tel) (81) 426 56 7832 (fax) (81) 426 56 7840

Latin America: (tel) (305) 269 7500 (fax) (305) 269 7599

Australia: (tel) 1 800 629 485 (fax) (61 3) 9210 5947

New Zealand: (tel) 0 800 738 378 (fax) 64 4 495 8950

Asia Pacific: (tel) (852) 3197 7777 (fax) (852) 2506 9284

Product specifications and descriptions in this document subject to change without notice.

Copyright © 2001 Agilent Technologies Printed in Germany. 07/01 p/n 5988-1067EN

